

١	DUTY ON WHICH ENGAGED:	COURT OF INQUIRY, INVESTIGATING OFFICER)
}	Armament exercise.	OR COMMANDING OFFICER'S REPORT: MULT	
)	NATURE OF ACCIDENT AND STAGE OF FLIGHT:	DATE: TCA/UBF/WWG.)
)	Aircraft 8200 was taxiing in after	COMPOSITION: MAKA	
)	normal landing. Left brake failed and aircraft hit A/C 7808 and FJ239	MATXA	
)	which were parked on the parking	they have)
)	strip.	RECOMMENDATIONS:)
, i		Suggested that piston rod be modified by drilling	Ś
)	PRIMARY CAUSE:	nut portion and locking it by wire to the small bolt holding forked end to the fitting on the rudder bar.	,
,	7. Brake failure.	nording forked end to the fitting on the fudder bar.	`
	Detachment of left master brake)
)	cylinder piston rod from brake clev	is action taken:)
)	causing failure of left brake due	(A) DISCIPLINARY (B) TECHNICAL (C) OTHER)
)	to failure of look-nut to hold assembly.	(B) Instructions issued re importance of correct)
)		assembly to ensure threaded portion of forked end enters at least 75% into piston rod and)
1	9. COLLISIONS	to check security of whole assembly on e very	ì
,	SECONDARY CAUSE OR CONTRIBUTING FACTORS:	minor inspection.	,
ł	3. Hitting other aircraft.	•	,
)_	35. Cross winds and gusts.	RECORDED BY DATE	
	36. BRAKE FAILURE (36)		
<i>*</i>	THILDRE OF	CHECKED BY DATE)
3)